

Processing Guide Secondary Insulation

PG-113 – Dip Solvent Borne Resin





Processing Guide PG-113 – Dip Solvent Borne Resin Process

Process Step	Optimum	Minimum	Comments
Preheat	1 hour at 135 -	None	Relax magnet wire,
	150°C(275 - 300°F)		drives out moisture,
	Once unit reaches		thermosets tapes,
	temperature		assists in penetration
Part Temperature	50 – 55°C	25 – 50°C	Temperature has a
when resin is	(120 - 130°F)	(77°F – 120°F)	direct bearing on
introduced			varnish penetration. If
			too low varnish will
			not penetrate fully. If
			too high varnish can
			be damaged
Submerge Units	4 inches per minute	Slow as possible	Hold to 10 – 15
			minutes or until
			bubbles cease
Raise units	4 inches per minute	Slow as possible	Slow removal allows
			good flow
Drain Time	10-15 minutes	None	Longer drain will re-
			capture more resin.
Bake Schedule	As recommended by	As recommended by	Full cure is required to
	product data sheet.	product data sheet.	develop all
			performance
			properties.

Please contact ELANTAS PDG, Inc. Technical Service if you have any questions.

Phone number 1.314.621.5700 Extension 717 or 1.800.325.7492 Extension 717

The above properties are typical values and are not intended for specification use.

ELANTAS PDG, Inc. warrants the chemical composition of its products within stated tolerances, but does not guarantee that a product will be appropriate for any particular application. Any recommendation, performance of tests or suggestion is offered merely as a guide and is not a substitute for a thorough evaluation by the manufacturer. No representative of ELANTAS PDG, Inc. has the authority to offer a warranty that a product will perform satisfactorily in manufacturing a product and no such representation should be relied upon.

